

Photo 1 – PC282126  
12/28/11



Photo 2 – PC282127  
12/28/11



Photo 3 – PC282128  
12/28/11



Photo 4 – PC282129  
12/28/11



Photo 5 – PC282130  
12/28/11



Photo 6 – PC282131  
12/28/11



Photo 7 – PC282132  
12/28/11



Photo 8 – PC282133  
12/28/11



Photo 9 – PC282134  
12/28/11



Photo 10 – PC282136  
12/28/11



Photo 11 – PC282137  
12/28/11



Photo12 – PC282141  
12/28/11



Photo 13 – PC282142  
12/28/11



Photo 14 – PC282144  
12/28/11



Photo 15 – PC282145  
12/28/11



Photo 16 – PC282146  
12/28/11



Photo 17 – PC282147  
12/28/11



Photo 18 – PC282149  
12/28/11




Photo 19 – PC282150  
12/28/11



Photo 20 – PC282152  
12/28/11

## Inspection Data Sheet: Leg C (Level 1 to Level 2)

Observ. No.	Location / Identification			Photo No.	Observation Comments
	Column	Elevation	Item <sup>1</sup>		
					<i>No distress noted</i>
<b>Sutro Tower</b>				Signature:	Page: <u>1</u> of <u>1</u>
<b>San Francisco, CA</b>				File:	Date: <u>12-28-11</u>

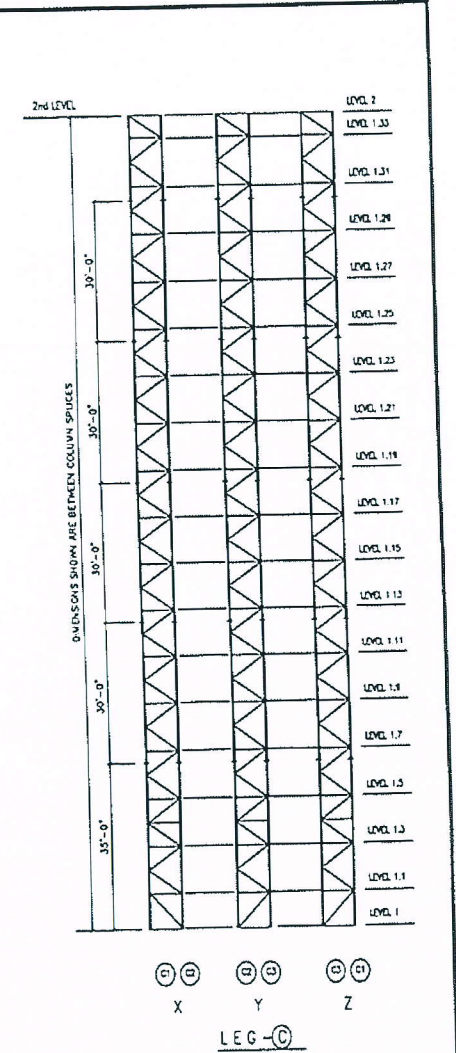

<sup>1</sup> Item designation: L=leg member, D=diagonal, H=horizontal, C=connection, O=others

# Inspection Data Sheet: South Truss (Level 2)


Observ. No.	Location / Identification			Photo No.	Inspection Comments
	Chord <sup>1</sup>	Horiz. Location	Item <sup>2</sup>		
1	M	2.6-7	H/C	<sup>no</sup> photo	RF (exterior)
2	U	2.1	C	1	RF (5)
3	L	2.1	C	2	RF (5)
4	U	2.1	C	3	RF
5	M	2.2	C	4	RW
6	L	2.1	C	5	RF (2)
7	L	2.3	V/C	6	RF
8	L	2.5	C	7	RF (3)
9	M	2.6	H	8	Rust on beam flange
10	L	2.7	C	9	RF (3)
11	U	2.7	C	10	RF
12	U	2.6	C	11	Rust on skin bracket
13	L	2.7	C	12	RF on antenna bracket
14	L	2.7	O	13	Rust on antenna strut
15	U	2.7	H/V	14	Rust on beams

<b>Sutro Tower</b>	Signature: <i>Nikhil Jy</i>	Page: <u>1</u> of <u>2</u>
<b>San Francisco, CA</b>	File:	Date: <u>12-28-11</u>

<sup>1</sup> Chord member designation: OU=outer upper, OL=outer lower, IU=inner upper, and IL=inner lower

<sup>2</sup> Item designation: H=horizontal, V=vertical, D=diagonal, C=connection, O=others

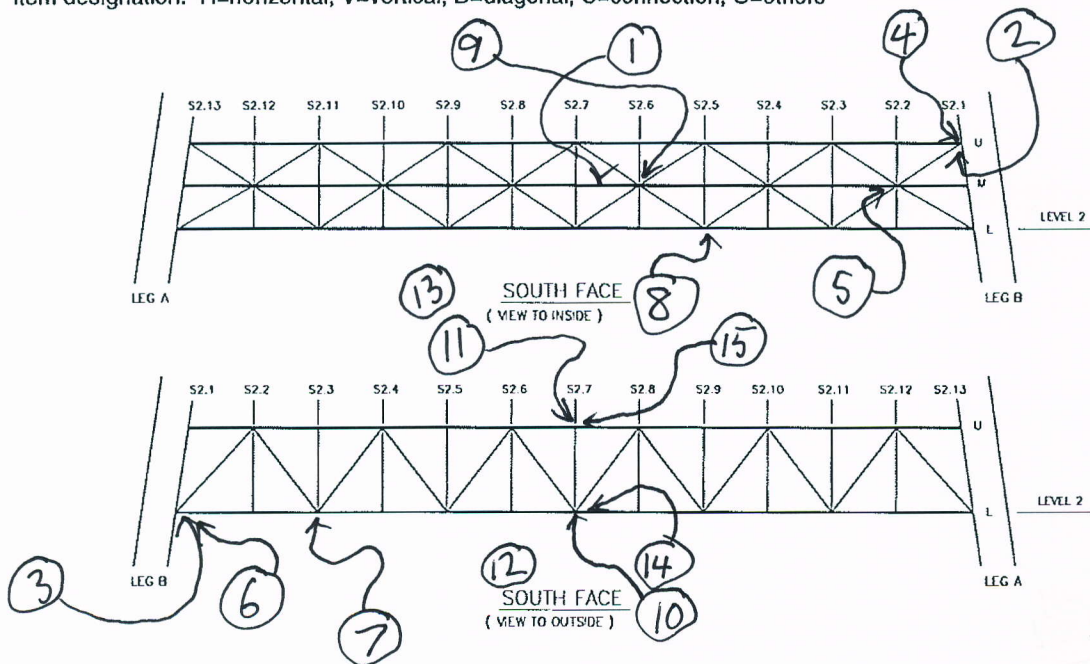

# Inspection Data Sheet: South Truss (Level 2)

Observ. No.	Location / Identification			Photo No.	Inspection Comments
	Chord <sup>1</sup>	Horiz. Location	Item <sup>2</sup>		
16	U	2.13	C	15, 16	RF(6)
17	L	2.13	H	17	Rust on beam
18	L	2.11	D	18	Rust on weld
<b>Sutro Tower</b>				Signature: <i>M. [Signature]</i>	Page: <u>2</u> of <u>2</u>
<b>San Francisco, CA</b>				File: <u>                    </u>	Date: <u>12-28-11</u>

<sup>1</sup> Chord member designation: OU=outer upper, OL=outer lower, IU=inner upper, and IL=inner lower  
<sup>2</sup> Item designation: H=horizontal, V=vertical, D=diagonal, C=connection, O=others

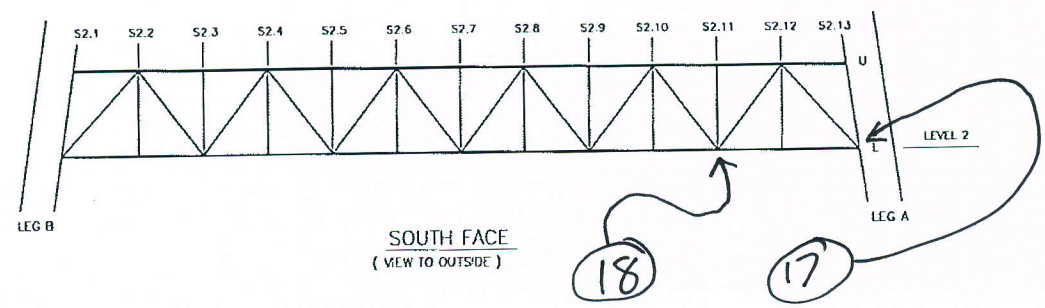
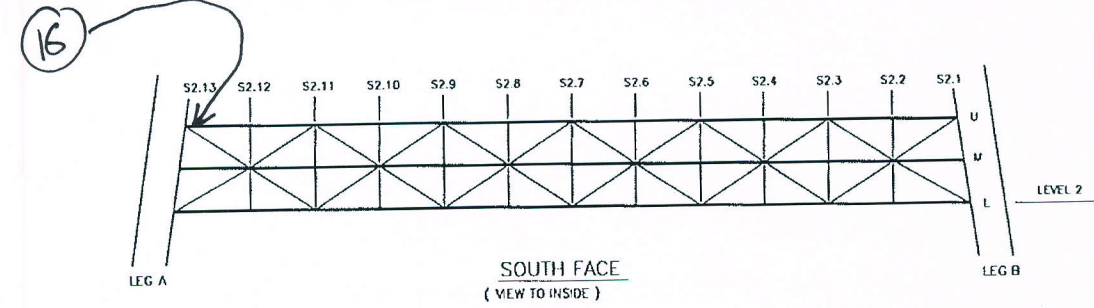






Photo 1 – PC282103  
12/28/11



Photo 2 – PC282104  
12/28/11

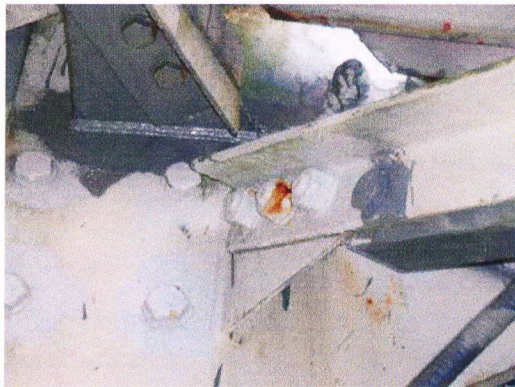


Photo 3 – PC282105  
12/28/11



Photo 4 – PC282107  
12/28/11

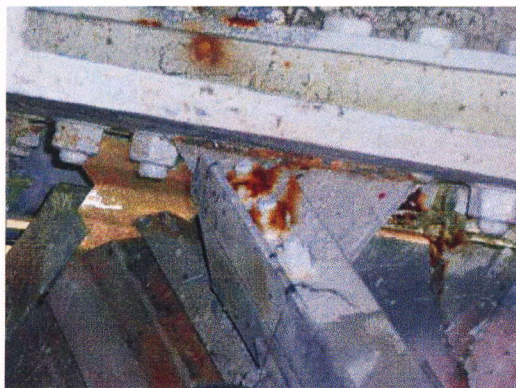


Photo 5 – PC282108  
12/28/11



Photo 6 – PC282109  
12/28/11



Photo 7 – PC282110  
12/28/11



Photo 8 – PC282112  
12/28/11



Photo 9 – PC282113  
12/28/11



Photo 10 – PC282115  
12/28/11



Photo 11 – PC282116  
12/28/11



Photo 12 – PC282117  
12/28/11

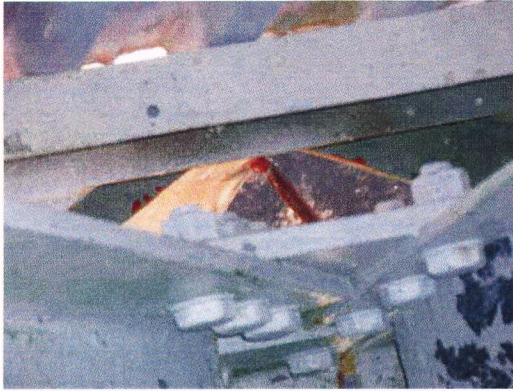


Photo 13 – PC282118  
12/28/11



Photo 14 – PC282119  
12/28/11

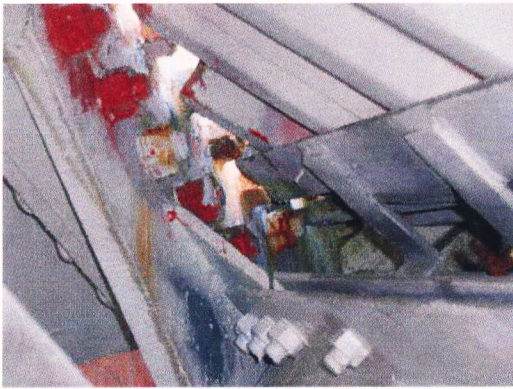


Photo 15 – PC282120  
12/28/11



Photo 16 – PC282121  
12/28/11

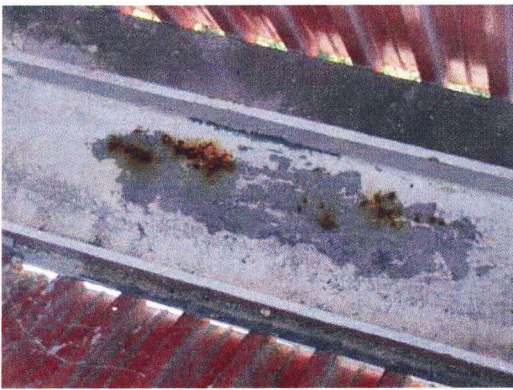


Photo 17 – PC282124  
12/28/11

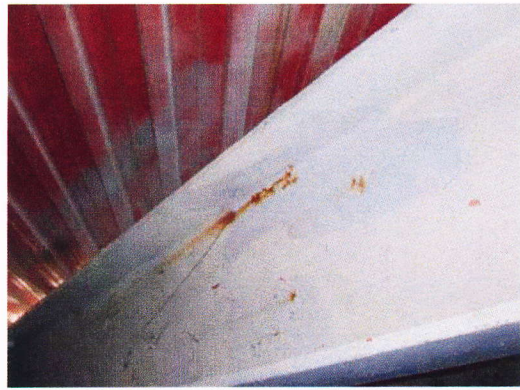


Photo 18 – PC282123  
12/28/11



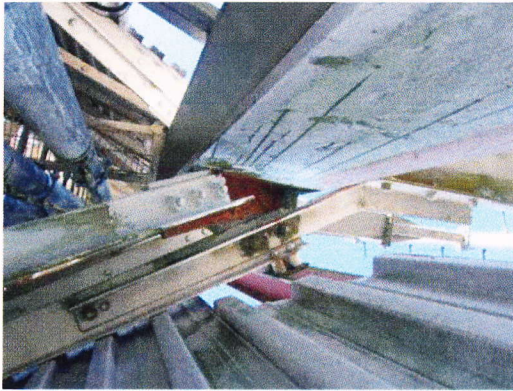


Photo 1 – PC282100  
12/28/11



Photo 2 – PC282101  
12/28/11

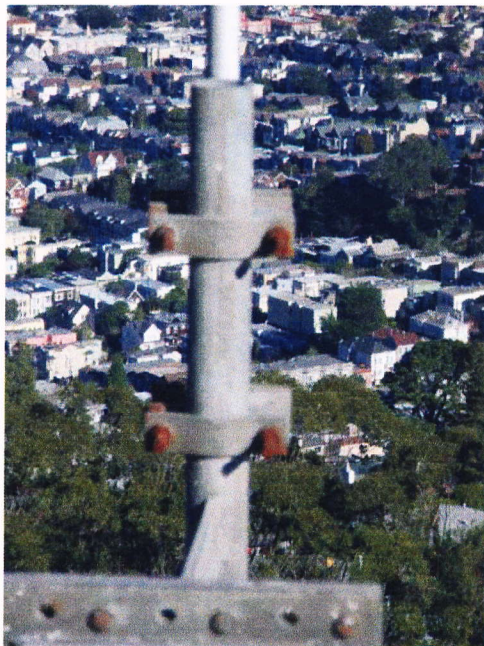


Photo 3 – PC282102  
12/28/11





Photo 1 – PC222045  
12/22/11

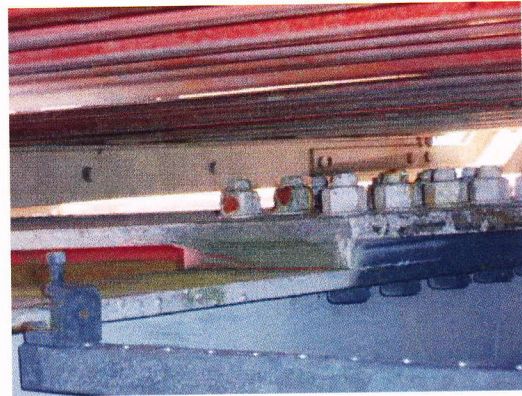


Photo 2 – PC222047  
12/22/11



Photo 4 – PC222049  
12/22/11

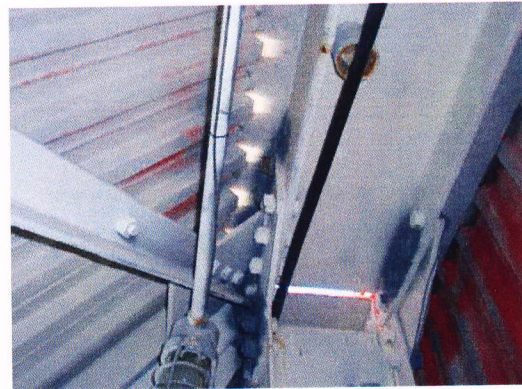


Photo 5 – PC222054  
12/22/11

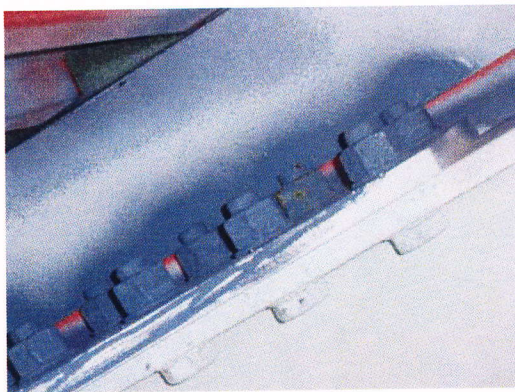


Photo 5 – PC222051  
12/22/11

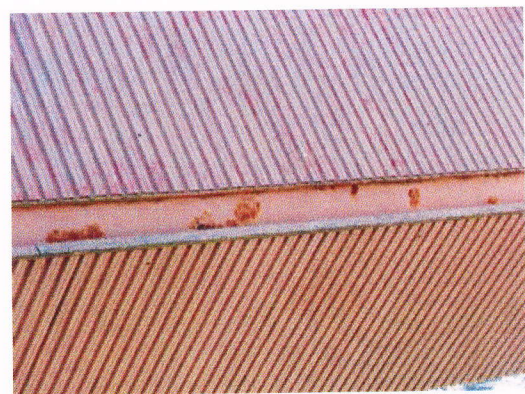


Photo 6 – PC282095  
12/28/11







Photo 1 – PC222039  
12/22/11



Photo 2 – PC222040  
12/22/11



Photo 3 – PC222041  
12/22/11

## Inspection Data Sheet: South Truss (Level 4)

Observ. No.	Location / Identification			Photo No.	Inspection Comments
	Chord <sup>1</sup>	Horiz. Location	Item <sup>2</sup>		
1	U	4.1	V/C	1	RF(6)
2	M	4.2	D/C	2	RF
3	L	4.2	V/C	3	RF(3)
4	U	4.2	C	4	RF on skin bracket
5	L	4.2	V/C	5	RF(4)
6	L	4.5	V/C	6	RF(2)
7	U	4.4	C	7	RF, Rust on beam flange
8	U	4.5	V/C	8	RF(2)
9	U	4.7	C	9	RF(2) and loose fastener
10	M	4.6	D/C	10	RF(2)
11	L	All	H	n/a	Rust on beam web, exterior
12	n/a	4.2	O	11,12	Rust on door hinges
<b>Sutro Tower</b>				Signature: <i>Richard D.</i>	Page: <u>1</u> of <u>1</u>
<b>San Francisco, CA</b>				File:	Date: <u>12-22-11</u>

<sup>1</sup> Chord member designation: OU=outer upper, OL=outer lower, IU=inner upper, and IL=inner lower

<sup>2</sup> Item designation: H=horizontal, V=vertical, D=diagonal, C=connection, O=others

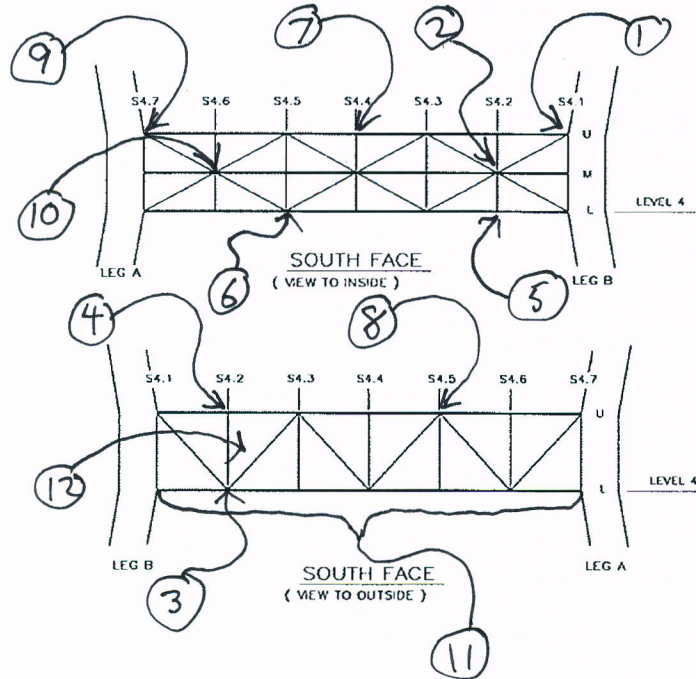




Photo 1 – PC222020  
12/22/11

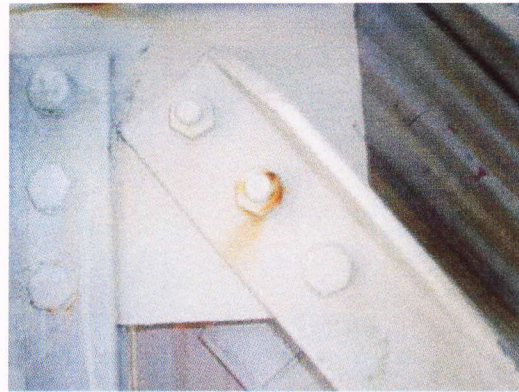


Photo 2 – PC222022  
12/22/11



Photo 3 – PC222023  
12/22/11



Photo – PC222025  
12/22/11



Photo 5 – PC222029  
12/22/11



Photo 6 – PC222032  
12/22/11

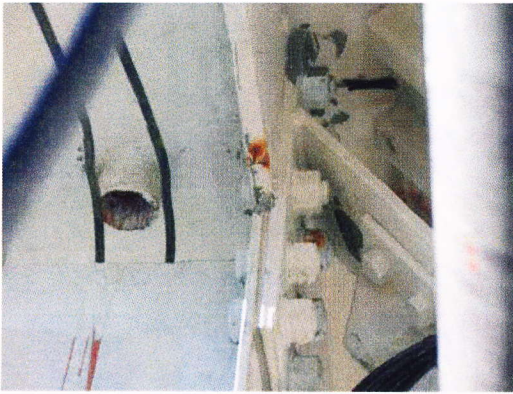


Photo 7 – PC222033  
12/22/11



Photo 8 – PC222035  
12/22/11



Photo 9 – PC222036  
12/22/11



Photo 10 – PC222037  
12/22/11

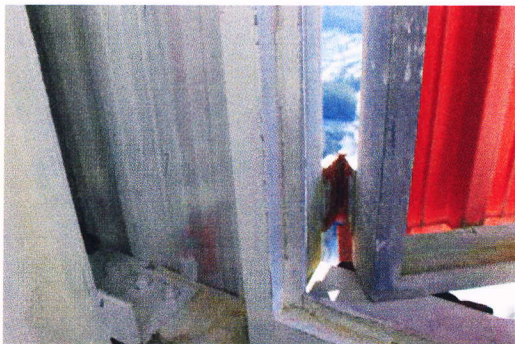


Photo 11 – IMG\_0865  
12/22/11



Photo 12 – IMG\_0864  
12/22/11